

Test Report

Number: GZHH00641099

Applicant: ZHONGSHAN JINLANG DAILY PRODUCTS CO.,LTD
NO.18,BAOSHENG FIRST STREET,XIAOLAN
TOWN,ZHONGSHAN CITY,GUANGDONG PROVINCE,
CHINA.

Date: Jul 21, 2026

Attn: 陈小姐

Sample Description:


Two (2) pieces of submitted sample said to be :

Item Name : **Safety Gate**

Item No. : **BG-16**

Date Sample Received : Apr 09, 2026 & Jun 23, 2026 & Jul 03, 2026 & Jul 13, 2026

Testing Period : Apr 09, 2026 to Jul 17, 2026

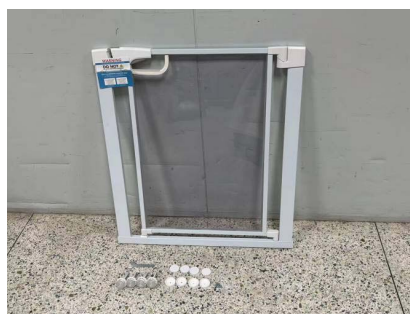

Tests conducted:

As requested by the applicant, refer to attached page(s) for details.

To be continued



Page 1 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District,
Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road,
Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、
601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Conclusion:

<u>Tested sample</u>	<u>Standard/Testing Item</u>	<u>Result</u>
Submitted samples	ASTM F1004-25 ^{e1} - Standard Consumer Safety Specification for Expansion Gates and Expandable Enclosures	Pass
	16 CFR 1239 (Incorporating by reference ASTM F1004-25) - Safety Standard for Gates and Enclosures	Pass
	16 CFR 1130 - Requirements for Consumer Registration of Durable Infant or Toddler Products	Pass
	<u>Standard - U.S. CFR Title 16 (CPSC Regulations)</u> Physical and mechanical tests	Pass
	Part 1500.3(C)(6)(vi) flammability test on rigid and pliable solids	Pass
	<u>Standard</u> Consumer Product Safety Improvement Act (CPSIA) 2008 Section 103 Tracking Labels for Children Products	Pass
	15 U.S.C. §2063(a)(5) (CPSA)	Pass
	Consumer Product Safety Act Section 14(a) (5)	Pass

	To be continued	



Page 2 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Conclusion:

<u>Tested sample</u>	<u>Standard/Testing Item</u>	<u>Result</u>
Tested component(s) of submitted sample(s)	U.S. Consumer Product Safety Improvement Act 2008 Title I, Sec 108(a) & (b)(3) and U.S. 16 CFR Part 1307 for Prohibition of Children's Toys and Child Care Articles Containing Specified Phthalates	Pass#
	U.S. 16 CFR Part 1303 total Lead content	Pass
	U.S. Consumer Product Safety Improvement Act 2008 Title I, Section 101(15 USC 1278a) for total Lead content in surface coating	Pass
	U.S. Consumer Product Safety Improvement Act 2008 Title I, Section 101(15 USC 1278a) for Total Lead content in substrate	Pass

Remark: # = The submitted samples were not subjected to the scope of the standard. The tests were performed as per the application's request.

Authorized by:
For Intertek Testing Services Shenzhen Ltd.
Guangzhou Branch, Hardlines


Victor T.J. Wang
General Manager



Should you have any query on this report, please click the link below:
https://verifyindex.intertek.com.cn/home/index?id=hl_report_verify



Page 3 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

1 Safety Specification for Expansion Gates/Expandable Enclosures

Test Standard: ASTM F1004-25^{ε1} - Standard Consumer Safety Specification for Expansion Gates and Expandable Enclosures.

Product Type: Expansion Gates.

Executive summary:

Clause	Testing Items	Result
1	Scope	
2	Referenced documents	
3	Terminology	
4	Calibration and standardization	
5	General requirements	
5.1	Wood parts	NA
5.2	Screws	P
5.3	Hazardous sharp edges or points	P
5.4	Small parts	P
5.5	Openings	P
5.6	Exposed coil springs	NA
5.7	Scissoring, shearing and pinching	P
5.8	Labeling	P
5.9	Paint and surface coating (16 CFR 1303)	P
5.10	Protective components	P
6	Performance requirements	
6.1.1	Completely-bounded openings	P
6.1.2	Height of sides	P
6.1.3	Vertical strength	P
6.1.4	Bottom spacing	P
6.1.5	Configuration of uppermost edge	P
6.2	Latching/Locking and hinge mechanisms	
6.2.1	Pressure-mounted gates	P
6.2.2	Unit with egress panels	P



Page 4 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

Clause	Testing items	Result
6.3	Horizontal push-out	P
6.4	Locking device	
6.4.1	Single-action	NA
6.4.2	Double-action	P
6.5	Toys	P
6.6	Slat strength test	P
6.7	Pressure-mounted gate-mounting hardware	P
6.8	Visual side-pressure Indicators	NA
6.9	Any features or openings within the gate that allow for unassisted pet entry or egress (shall not include)	P
7	Test methods	
8	Marking and labeling	P
9	Instructional literature	P

Abbreviation :P = Pass; NA = Not Applicable; NR = Not Requested by the Applicant



Page 5 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

2 Safety Standard for Gates and Enclosures

As per 16 CFR 1239 – Safety Standard for Gates and Enclosures, the submitted sample was subjected to the following tests in accordance with ASTM F1004-25.

Product type: Expansion gates.

Executive summary:

Clause	Testing Items	Result
1	Scope	
2	Referenced documents	
3	Terminology	
4	Calibration and standardization	
5	General requirements	
5.1	Wood parts	NA
5.2	Screws	P
5.3	Hazardous sharp edges or points	P
5.4	Small parts	P
5.5	Openings	P
5.6	Exposed coil springs	NA
5.7	Scissoring, shearing and pinching	P
5.8	Labeling	P
5.9	Paint and surface coating (16 CFR 1303)	P
5.10	Protective components	P
6	Performance requirements	
6.1.1	Completely-bounded openings	P
6.1.2	Height of sides	P
6.1.3	Vertical strength	P
6.1.4	Bottom spacing	P
6.1.5	Configuration of uppermost edge	P
6.2	Latching/Locking and hinge mechanisms	
6.2.1	Pressure-mounted gates	P
6.2.2	Unit with egress panels	P



Page 6 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

Clause	Testing items	Result
6.3	Horizontal push-out	P
6.4	Locking device	
6.4.1	Single-action	NA
6.4.2	Double-action	P
6.5	Toys	P
6.6	Slat strength test	P
6.7	Pressure-mounted gate-mounting hardware	P
6.8	Visual side-pressure Indicators	NA
6.9	Any features or openings within the gate that allow for unassisted pet entry or egress (shall not include)	P
7	Test methods	
8	Marking and labeling	P
9	Instructional literature	P

Abbreviation: P = Pass; NA = Not Applicable; NR = Not Requested by the Applicant



Page 7 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

3 Requirements for Consumer Registration of Durable Infant or Toddler Products


As per the client's requirements, with reference to 16 CFR 1130 - Requirements for Consumer Registration of Durable Infant or Toddler Products, the submitted sample was subjected to the following tests.

Executive Summary:

Clause	Requirements	Result
1130.3	General requirements	P
1130.4	Identification on the product	P
1130.5	Requirements for registration forms	P
1130.6	Requirements for format and text of registration forms	P
1130.7	Requirements for Web site registration or alternative email registration	P

Abbreviation: P = Pass

Photos of tested sample for reference

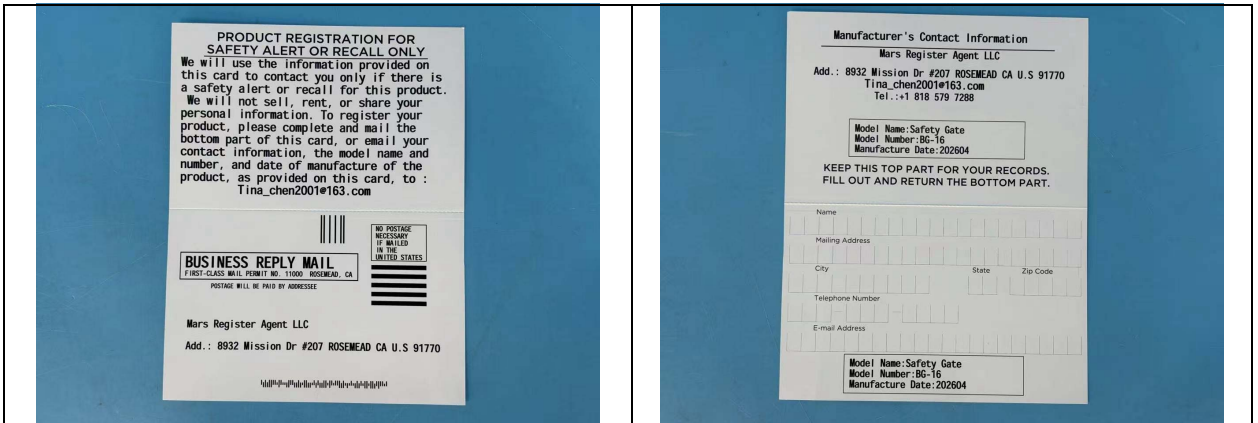

Test Report

Number: GZHH00641099

Tests Conducted

4 Physical and Mechanical Tests

As per U.S. Code of Federal Regulations Title 16 part 1500.50, the hazards of sharp points, sharp edge and small parts are assessed both before and after applicable use and abuse tests.

Applicant's specified age group for testing: 6-24 Months

	No. of sample tested	Sharp Point (1500.48)	Sharp Edge (1500.49)	Small Part (1501)
As received	1	P	P	P
Impact test (1500.51(b))	1	P	P	P
Flexure test (1500.52(d))	0	NA	NA	NA
Torque test (1500.52(e))	1	P	P	P
Tension test (1500.52(f))	1	P	P	P
Compression test (1500.52(g))	1	P	P	P

Remark: P = Pass NA = Not Applicable

5 Flammability test

As per U.S. Code of Federal Regulations Title 16 Part 1500.44 for rigid and pliable solids

Result : Ignited but self-extinguished before burn rate could be determined



Page 9 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

6 Tracking Label Assessment

As per consumer product safety Act section 14(a) (5), 15 U.S.C. §2063(a)(5) (CPSA) and Consumer Product Safety Improvement Act (CPSIA) 2008 Section 103 Tracking Labels for Children Products

Tracking label found on the packaging:

Name of manufacturer / importer / private labeler:	ZHONGSHAN JINLANG DAILY PRODUCTS CO.LTD
Location of production:	No.18,BAOSHENG FIRST STREET,XIAOLAN TOWN,ZHONG SHAN CITY ,GUANGDONG PROVINCE, CHINA
Date code:	202604

Tracking label found on the product:

Name of manufacturer / importer / private labeler:	ZHONGSHAN JINLANG DAILY PRODUCTS CO.LTD
Location of production:	No.18,BAOSHENG FIRST STREET,XIAOLAN TOWN,ZHONG SHAN CITY ,GUANGDONG PROVINCE, CHINA
Date code:	202604

Note: The tracking label assessment was based on the submitted sample and the information provided by the applicant. There was no verification on the validity of such information.



Page 10 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

7 Phthalate Content (U.S. CPSIA Section 108(a) & (b)(3) and U.S. 16 CFR Part 1307)

With reference to CPSC-CH-C1001-09.4, by Gas Chromatographic-Mass Spectrometric (GC-MS) analysis.

Test Item	CAS No.	Result					Units	D.L.	Limit
		1+2+3	4+5+6	7	8	9			
Dibutyl phthalate (DBP)	84-74-2	ND	ND	ND	0.018	ND	%	0.01	0.1
Di-(2-ethylhexyl) phthalate (DEHP)	117-81-7	ND	ND	ND	ND	ND	%	0.01	0.1
Benzyl butyl phthalate (BBP)	85-68-7	ND	ND	ND	ND	ND	%	0.01	0.1
Di-isononyl phthalate (DINP)	28553-12-0 68515-48-0	ND	ND	ND	ND	ND	%	0.01	0.1
Di-isobutyl phthalate (DIBP)	84-69-5	ND	ND	ND	ND	ND	%	0.01	0.1
Di-n-pentyl phthalate (DPENP)	131-18-0	ND	ND	ND	ND	ND	%	0.01	0.1
Di-n-hexyl phthalate (DnHP/DHEXP)	84-75-3	ND	ND	ND	ND	ND	%	0.01	0.1
Di-cyclohexyl phthalate (DCHP)	84-61-7	ND	ND	ND	ND	ND	%	0.01	0.1



Page 11 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com


Test Report

Number: GZHH00641099

Tests Conducted

Test Item	CAS No.	Result					Units	D.L.	Limit
		10	11	12	13+14	15+16			
Dibutyl phthalate (DBP)	84-74-2	ND	ND	ND	ND	ND	%	0.01	0.1
Di-(2-ethylhexyl) phthalate (DEHP)	117-81-7	ND	ND	ND	ND	ND	%	0.01	0.1
Benzyl butyl phthalate (BBP)	85-68-7	ND	ND	ND	ND	ND	%	0.01	0.1
Di-isononyl phthalate (DINP)	28553-12-0 68515-48-0	ND	ND	ND	ND	ND	%	0.01	0.1
Di-isobutyl phthalate (DIBP)	84-69-5	ND	ND	ND	ND	ND	%	0.01	0.1
Di-n-pentyl phthalate (DPENP)	131-18-0	ND	ND	ND	ND	ND	%	0.01	0.1
Di-n-hexyl phthalate (DnHP/DHEXP)	84-75-3	ND	ND	ND	ND	ND	%	0.01	0.1
Di-cyclohexyl phthalate (DCHP)	84-61-7	ND	ND	ND	ND	ND	%	0.01	0.1

Remarks:

D.L. = Detection Limit

ND = Not detected

The above limit was quoted according to U.S. Consumer Product Safety Improvement Act 2008 Title I, Sec 108(a) & (b)(3) and U.S. 16 CFR Part 1307 for Prohibition of Children's Toys and Child Care Articles Containing Specified Phthalates.

Tested Components: See component list in the last section of this report.



Page 12 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com


Test Report

Number: GZHH00641099

Tests Conducted

8 Total Lead (Pb) Content (U.S. 16 CFR Part 1303)

As per Standard Operating Procedure for Determining Lead (Pb) in paint and other similar surface coatings, test method CPSC-CH-E1003-09.1 was used and total Lead content was determined by Inductively Coupled Plasma - Optical Emission Spectrometry.

Test Item	Result					Units	D.L.	Limit
	1+2+3	10	-	-	-			
Lead (Pb)	0.0015	ND	-	-	-	%	0.001	0.009

Remarks:

D.L. = Detection Limit

ND = Not detected

The above limit was quoted according to U.S. 16 CFR Part 1303 for Ban of Lead-containing Paint and Certain Consumer Products Bearing Lead-containing Paint.

Tested Components: See component list in the last section of this report.

9 Total Lead (Pb) Content in Surface Coating (U.S. 16 CFR Part 1303 and CPSIA Section 101(15 USC 1278a))

As per Standard Operating Procedure for Determining Lead (Pb) in paint and other similar surface coatings, test method CPSC-CH-E1003-09.1 was used and total Lead content was determined by Inductively Coupled Plasma - Optical Emission Spectrometry.

Test Item	Result					Units	D.L.	Limit
	1+2+3	10	-	-	-			
Lead (Pb)	15	ND	-	-	-	mg/kg	10	90

Remarks:

D.L. = Detection Limit

The above limit was quoted according to U.S. 16 CFR Part 1303 and U.S. Consumer Product Safety Improvement Act 2008 Title I, Section 101(15 USC 1278a) for total Lead content in surface coating.

ppm = parts per million = mg/kg

ND = Not detected

Tested Components: See component list in the last section of this report.



Page 13 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com



Test Report

Number: GZHH00641099

Tests Conducted

10 Total Lead (Pb) Content in Substrate (U.S. CPSIA Section 101(15 USC 1278a))

As per Standard Operating Procedures for Determining total Lead (Pb) in children's products, test methods CPSC-CH-E1002-08.3 and/or CPSC-CH-E1001-08.3 were used and total Lead content was determined by Inductively Coupled Plasma - Optical Emission Spectrometry and/or Atomic Absorption Spectrometry.

Test Item	Result					Units	D.L.	Limit
	4+5+6	7	8	9	11			
Lead (Pb)	ND	ND	ND	ND	ND	mg/kg	10	100
Test Item	Result					Units	D.L.	Limit
	20	12	13+14	15+16	17+18+19			
Lead (Pb)	ND	ND	ND	ND	ND	mg/kg	10	100

Remarks:

D.L. = Detection Limit

The above limit was quoted according to U.S. Consumer Product Safety Improvement Act 2008 Title I, Section 101(15 USC 1278a) for total Lead content in substrate.

ppm = parts per million = mg/kg

ND = Not detected

Tested Components: See component list in the last section of this report.

Component List

No.	Test Component Description(s)
(1)	Black coating on metal (frame of black style).
(2)	Khaki coating on metal (frame of khaki style).
(3)	White coating on metal (frame of white style).
(4)	Black plastic (corner, connector of window of black style).
(5)	Khaki plastic (corner, connector of window of khaki style).
(6)	White plastic (corner, connector of window of white style).
(7)	Transparent plastic (window of all styles).
(8)	Semi-transparent glue (fastener of window of all styles).
(9)	Semi-transparent soft plastic (edge of window of all styles).
(10)	Coatings (light black, black, orange, dull orange) on plastic label (tracking label, warning label).



Page 14 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com


Test Report

Number: GZHH00641099

Tests Conducted

Component List

No.	Test Component Description(s)
(11)	White plastic label excluding coatings (tracking label, warning label).
(12)	Light grey plastic (button, switch of all styles).
(13)	Bright black plastic (rotary knob, round cap of black style).
(14)	Semi-transparent white soft plastic (pad of blot of all styles).
(15)	Bright khaki plastic (rotary knob, round cap of khaki style).
(16)	Dull white plastic (rotary knob, round cap of white style).
(17)	Bright silver color metal (blot of all styles).
(18)	Silver color metal (screw of all styles).
(19)	Silver color metal excluding coating (frame of all styles).
(20)	Silver color solder excluding coating (fastener of frame of all styles).

End of report

The statements of conformity reported have considered the decision rule agreed, namely that Intertek have taken account of measurement uncertainty as calculated by Intertek, and applied according to ILAC-G8/09:2019 (Non-binary acceptance based on guard band $w = U$) except designation from the customer, regulation or test specification. This decision rule only applies to the numeric test results.

The sample(s) and sample information hereto are provided by the client who shall be solely responsible for the authenticity and integrity thereof. The results shown in this report relate only to the sample(s) tested. It is not intended to be a recommendation for any particular course of action. Intertek does not accept a duty of care or any other responsibility to any person other than the Client in respect of this report and only accepts liability to the Client insofar as is expressly contained in the terms and conditions governing Intertek's provision of services to you. Intertek makes no warranties or representations either express or implied with respect to this report save as provided for in those terms and conditions. We have aimed to conduct the Review on a diligent and careful basis and we do not accept any liability to you for any loss arising out of or in connection with this report, in contract, tort, by statute or otherwise, except in the event of our gross negligence or wilful misconduct. This report shall not be reproduced unless with prior written approval from Intertek Testing Services Shenzhen Limited, Guangzhou Branch.



Page 15 of 15

Intertek Testing Services Shenzhen Limited, Guangzhou Branch

深圳天祥质量技术服务有限公司广州分公司

111, Huichuang Kongjian, TCL Cultural Industrial Park, No.69, Guangpu Road, Huangpu District, Guangzhou, Guangdong, China. / Room 401/501/601/801/901/1003, No. 8, East BaoYing Road, Huangpu District, Guangzhou, China

广州市黄埔区光谱西路 69 号 TCL 文化产业园汇创空间 111 室/广州市黄埔区保盈东路 8 号 401 房、501 房、

601 房、801 房、901 房、1003 房

Tel +8620 28209114
intertek.com.cn
intertek.com

